

operating instructions / spare parts GL 222 DC

Portable Inverter





Carl Cloos Schweisstechnik GmbH Industriestrasse 35708 Haiger Germany

Telefon (0 27 73) 85-0
Telefax (0 27 73) 85-275
E-Mail: info@cloos.de

Internet: http://www.cloos.de

RW - FP - Rev.0 03.06.15

Keep for further use.

CARL CLOOS Schweißtechnik GmbH Industriestrasse D-35708 Haiger Tel.(+49) 2773/85-0

Fax.(+49) 2773/85-275 mail: info@cloos.de www.cloos.de

Document: QIGL222DC



Month/Year 10/12

EC-Declaration of Conformity

in accordance with EC Directives 2006/95/EG (low voltage) and 2004/108/EG (EMV)

We herewith certify that the welding machine mentioned below has been developed, designed and manufactured in accordance with the EC Directives and brought on the market.

Designation of machine des Gerätes: TIG welding machine

Type: QINEO GL 222 DC

Serial number: see type plate (on the rear of the machine)

The following EC Directives have been applied:

- EC Low voltage directives (2006/95/EG)
- EC Directives on Electromagnetic compatibility (2004/108/EG)
- EC Directives RoHS (2002/95/EG)

The following harmonised standards have been applied:

- EN 60974-1: Arc welding equipment

Part 1: Welding power sources

- EN 60974-3 Arc welding equipment

Part 3: Arc striking and stabilizing devices

- EN 60974-10: Arc welding equipment

Part 10: Electromagnetic compatibility (EMC) requirements

Any significant modifications or extensions on the machine which are not carried out by the above

Dipl.-Kfm. Ralf Pulverich Manufacturer's signature:

Information on the signatory: Managing Director

ENGLISH

1	INTRODUCTION	.4
2	FRONT PANEL	
3	REAR PANEL	
4	INSTALLATION	5
4.1	CONNECTIONS TO THE ELECTRICAL MAINS NETWORK	
4.2	PREPARING FOR MMA WELDING	
4.3	PREPARING FOR TIG WELDING	
5	USER INTERFACE	8
6	LINIT POWFR-LIP	9
7	RESET (LOAD FACTORY SETTINGS)	9
7.1	PARTIAL RESET	9
7.2	TOTAL RESET	
8	SET-UP (INITIAL SET-UP OF THE WELDING POWER	
	SOURCE)	10
8.1	TORCH LOADING	
9	ALARMS MANAGEMENT	12
	THERMAL ALARM!	
	COOLING DEVICE ALARM	12
10	WELDING PARAMETERS	
	Welding current	
	Max welding current	
	Hot-start	
	Arc-force	
	VRD	
	Long arc voltage	
	Dynamic arc	
	Second current Bi-level	13
	Base current	
	Peak time	14
	Base time	
	Pulse frequency	
	Slope down	
	Final current	
	Post-gas Pre-gas	14 1 <i>1</i>
	Start current	
	Slope up	
	Spot TIG time	
	HF arc start	14
	Minimum pedal current	
	Q-start	
10.1	Multi-tack	
10.1	PARAMETERS ACTIVATION	
11	WELDING SETTINGS	
11.1	ELECTRODE WELDING (MMA)	
11.1.1 11.1.2	MMA PARAMETERS SETTING (1ST LEVEL)MMA PARAMETERS SETTING (2ND LEVEL)	
11.1.3	MMA SPECIAL FUNCTIONS	
11.2	DC TIG WELDING	
11.2.1	DC TIG PARAMETERS SETTING (1ST LEVEL)	17
11.2.2	DC TIG PARAMETERS SETTING (2ND LEVEL)	17
11.2.3	DC TIG SPECIAL FUNCTIONS MENU	
12	JOBS MANAGEMENT	19
12.1	SAVING A JOB	
12.2	LOADING A USER JOB OF FACTORY SET JOB	19
12.3	DELETING A JOB	
13	TORCH TRIGGER MODES	
13.1	2T LIFT-ARC WELDING	
13.2	2T HF WELDING	
13.3	4T LIFT-ARC WELDING	
13.4	4T HF WELDING	
13.5	BI-LEVEL LIFT WELDING	
13.6	BI-LEVEL HF WELDING	
13.7	2T SPOT WELDING	
13.8	2T SPOT HF WELDING	
13.9	PILOT ARC WELDING	22

14	TECHNICAL DATA	23
	SPARE PARTS	
	ELECTRICAL DIAGRAM	
16.1	GL 222 DC	26
16.2	TORCH CONNECTOR	27
16.3	REMOTE CONTROLLER CONNECTOR	27

ENGLISH

1 INTRODUCTION



IMPORTANT!

This handbook must be consigned to the user prior to installation and commissioning of the unit.

Read the "General prescriptions for use" handbook supplied separately from this handbook before installing and commissioning the unit.

The meaning of the symbols in this manual and the associated precautionary information are given in the "General prescriptions for use".

If the "General prescriptions for use" are not present, it is mandatory to request a replacement copy from the manufacturer or from your dealer.

Retain these documents for future consultation.

KEY



This symbol identifies an action that occurs automatically as a result of a previous action.

- This symbol identifies additional information or a reference to a different section of the manual containing the associated information.
- § This symbol identifies a reference to a chapter of the manual.



This symbol accompanies important information concerning the execution of the relevant operations.

GL 222 DC is an inverter-based welding power source complete with all the functions required for DC TIG and MMA welding with excellent arc characteristics.

The solidity of the components of this unit makes it a reliable working companion for workshop and outdoor applications.

This unit is ideal for maintenance, food industry, hydraulics, oil pipelines and chemical plants.

The parameters preset in the DC TIG pulsed synergic curve simplify welding by regulation exclusively of the current.

The current is adjustable also from the Up-Down torch.

The simply and intuitive interface allows high precision adjustments with 50 storable programs.


The wide range of adjustable pulsed frequency in combination with the complementary parameters (base current and duty cycle) makes it possible to weld in slow and fast pulsed mode. The welding modes and procedures available are those indicated in the table.

MODE		PROCEDURE
F MMA		
	 Z-SPT	2T SPOT
CONTINUOUS	U+SPI+ HF	2T SPOT + HF
	- J	2 STEP LIFT-ARC (2T)
	 #HF	2 STEP + HF (2T HF)
	_00	4 STEP LIFT-ARC (4T)
	<i>M</i> +HF	4 STEP + HF (4T HF)
SYN SYNERGIC TIG	Mu.HF	4 STEP BI-LEVEL (4T B-LEVEL) 4 STEP BI-LEVEL + HF (4T B-LEVEL HF)

Accessories that can be connected to the unit:


- manual remote controller for remote adjustment of the welding current.
- foot-pedal remote controller for TIG torch arc striking and remote adjustment of welding current.
- UP/DOWN torch or torch with potentiometer.
- liquid cooler for TIG torches.

2 FRONT PANEL

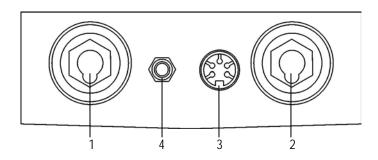

- 1: Negative pole welding socket.
- 2: Positive pole welding socket.
- 3: Connector for logic signals of TIG torch.
- 4: Connector for gas feed hose: power source → torch

3 REAR PANEL

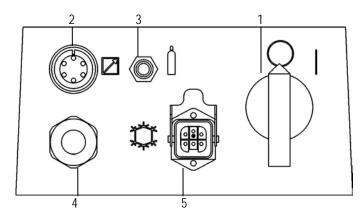

- 1: Welding power source ON/OFF switch.
- 2: Remote controller connector.
- 3: Connector for gas feed hose: cylinder → power source
- 4: Power cable.

Total length (including internal part)	2,5 m
Number and cross section of wires	3 x 2,5 mm ²
Type of plug supplied	Schuko

5: Cooler power feeding connector.

Voltage	230 V~
Current output	1.35 A
IP protection rating	IP20 (cap open) IP66 (cap closed)



WARNING! High voltage!

If the socket is not connected to any devices always close the cap: presence of hazardous voltage levels!

4 INSTALLATION



4.1 CONNECTIONS TO THE ELECTRICAL MAINS NETWORK


The characteristics of the mains power supply to which the equipment shall be connected are given in the section entitled "technical data" on page 23.

The machine can be connected to motorgenerators provided their voltage is stabilised.


Connect/disconnect the various devices with the machine switched off.

4.2 PREPARING FOR MMA WELDING

- 1. Set the welding power source ON/OFF switch to "O" (unit deenergized).
- 2. Plug the power cable plug into a mains socket outlet.

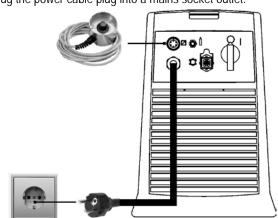

- 3. Choose the electrode based on the type of material and thickness of the workpiece to be welded.
- 4. Insert the electrode in the electrode holder.
- 5. Connect the electrode holder clamp plug to the following welding socket: Positive pole welding socket.
- 6. Connect the earth clamp plug to the following welding socket: Negative pole welding socket.
- 7. Connect the earth clamp to the workpiece being processed.

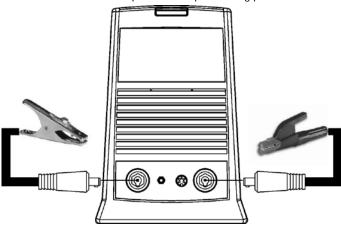



- 8. Set the welding power source ON/OFF switch to "I" (unit powered).
- 9. Select the following welding mode on the user interface: MMA
- 10. Set the required welding parameter values on the user interface.
- ①When the remote controller [RC] is connected and the relative locking screw is tightened, welding current can be adjusted using the remote controller.


The system is ready to start welding.

ENGLISH


4.3 PREPARING FOR TIG WELDING

Installation with cooling unit


- 1. Set the welding power source ON/OFF switch to "O" (unit deenergized).
- 2. Remove the screws from the power source cabinet.

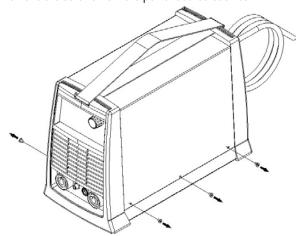


3. Loosen the screws of the upper brackets of the cooler and open out the brackets slightly.

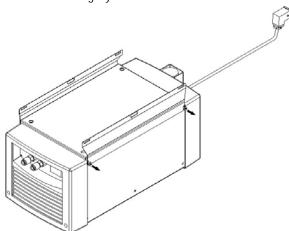


- 4. Place the power source on top of the cooler.
- Secure the cooler brackets to the power source using the previously removed screws.

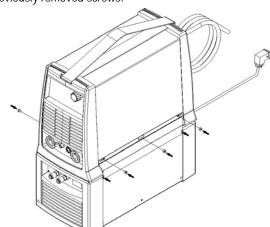

- 6. Connect the plug of the cooler power cable to the cooler power socket on the rear panel of the welding power source.
- 7. Set the cooler ON/OFF switch to "I" (unit powered).
- 8. Plug the power cable plug into a mains socket outlet.

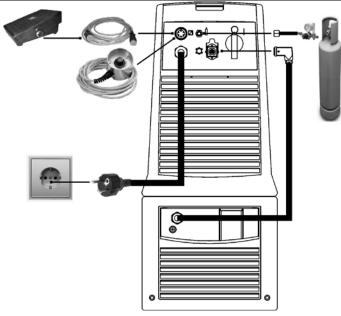

- 9. Connect the gas hose from the welding gas cylinder to the rear gas socket.
- 10. Open the cylinder gas valve.

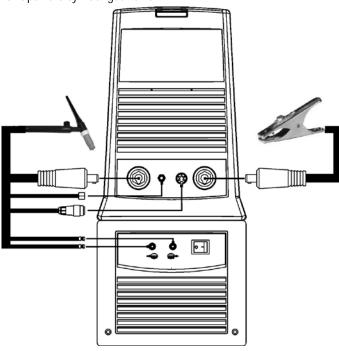

- 11. Connect the gas hose from the welding torch to the front gas socket.
- 12. Connect the torch plug to the following welding socket: Negative pole welding socket.
- 13. Choose the electrode based on the type of material and thickness of the workpiece to be welded.
- 14. Insert the electrode in the TIG torch.
- 15. Connect the earth clamp to the workpiece being processed.
- 16. Set the welding power source ON/OFF switch to "I" (unit powered).
- 17. Select the following welding mode on the user interface: DC TIG
- 18. Press the torch trigger with the torch well clear of any metal parts. This serves to open the gas solenoid valve without striking the welding arc.
- 19. Use the flow control valve to adjust the flow of gas as required while the gas is flowing out.

Cod.006.0001.1401 03/06/2015 v2.3 **ENGLISH**


GL 222 DC

- 20. Set the required welding parameter values on the user interface.
- ① When the remote control pedal is connected and the relative locking screw is tightened the welding current will vary in relation to the pressure exerted on the pedal.

The system is ready to start welding.

5

USER INTERFACE

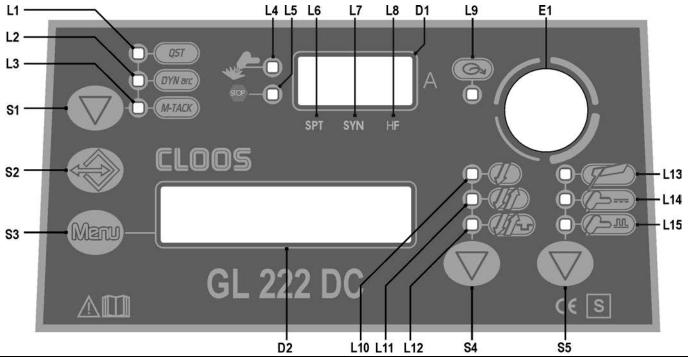

L1 DST Illumination shows that the following function has been activated: DYNAMIC ARC L3 M*TACK Illumination shows that the following function has been activated: DYNAMIC ARC L4			D2 L10 L11 L12 S4 S5
Illumination shows that the following function has been activated: DYNAMIC ARC	CODE	SYMBOL	DESCRIPTION
Illumination shows that the following function has been activated: MULTITACK	L1	QST .	Illumination shows that the following function has been activated: Q-START
Illumination shows that the following function has been activated: MULTITACK	L2	DYN arc	Illumination shows that the following function has been activated: DYNAMIC ARC
This LED illuminates to confirm the presence of power on the output sockets. This LED illuminates to show an anomaly in the operating conditions. See "ALARMS MANAGEMENT" (§ 9 page 12). Illumination shows that the following function has been activated: 2 times Spot procedure \$\overline{1}\$ \$13.7 page 22 / \$1.38 page 22 When this LED illuminates the following parameter can be set: TIG SYNERGIC PULSE When this is on, it means that the synergic mode is active and that the operator can set just the welding current while the other parameters are automatically regulated by the machine. The synergy is optimised by angle welding. Illumination shows that the following function has been activated: 4 page 12 page 1	L3	M-TACK	Illumination shows that the following function has been activated: MULTI TACK
This LED illuminates to show an anomaly in the operating conditions. SPT Illumination shows that the following function has been activated: 2 times Spot procedure 1 13.7 page 22.7 § 13.8 page 22.7 When this LED illumination shows that the following parameter can be set: TIG SYNERGIC PULSE When this is on, it means that the synergic mode is active and that the operator can set just the welding current while the other parameters are automatically regulated by the machine. The synergy is optimised by angle welding. It when the legible of the following function has been activated: High frequency arc strike (HF) Illumination shows that the following function has been activated: 4 times procedure It is litumination shows that the following function has been activated: 4 times procedure Illumination shows that the following function has been activated: 4 times procedure It is 13.1 page 20.7 § 13.4 page 21 Illumination shows that the following function has been activated: 4 times procedure It is 13.3 page 20.7 § 13.4 page 21 Illumination shows that the following function has been activated: 4 times procedure It is 13.5 page 20.7 § 13.6 page 21 Illumination shows that the following welding mode is selected: MMA It is 14.5 Illuminates to show that the following welding mode is selected: TIG CONTINUOUS This LED illuminates to show that the following welding mode is selected: TIG PULSED Parameters/functions setting: 1st level menu: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: 2nd level menu: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: The displays show the selected parameter and its value. Welding: The displays show the average instantaneous voltage value. HOLD function: The displays show the selected parameter and its value. Welding: The displays show the average instantaneous voltage value of the last weld executed. The HOLD value is cleared when a new weld is started, or when any actio	L4	***	This LED illuminates to confirm the presence of power on the output sockets.
SPT This LED illuminates the following parameter can be set: TIG SYNERGIC PULSE	L5		
When this is on, it means that the synerigic mode is active and that the operator can set just the welding current while the other parameters are automatically regulated by the machine. The synergy is optimised by angle welding. Illumination shows that the following function has been activated: High frequency arc strike (HF) This LED indicates that the current reference setting is imposed by the remote controller. Illumination shows that the following function has been activated: 2 times procedure (1) § 13.1 page 20 / § 13.2 page 20 Illumination shows that the following function has been activated: 4 times procedure (1) § 13.3 page 20 / § 13.4 page 21 Illumination shows that the following function has been activated: 4 times procedure (1) § 13.5 page 21 / § 13.6 page 21 Illumination shows that the following function has been activated: 4 times Bi-level procedure (1) § 13.5 page 21 / § 13.6 page 21 This LED illuminates to show that the following welding mode is selected: MMA Interpolation of the state of the user interface. December 3/machines setting: The displays show the average voltage value. HOLD function: The displays show the average voltage value of the last weld executed. The "HOLD" value is cleared when a new weld is started, or when any action is performed on the user interface. December 3/machines of the state of the stat	L6	SPT	
This LED indicates that the current reference setting is imposed by the remote controller. L10 Illumination shows that the following function has been activated: 2 times procedure (i) § 13.1 page 20 / § 13.2 page 20 Illumination shows that the following function has been activated: 4 times procedure (i) § 13.3 page 20 / § 13.4 page 21 Illumination shows that the following function has been activated: 4 times Bi-level procedure (i) § 13.5 page 21 / § 13.6 page 21 Illumination shows that the following function has been activated: 4 times Bi-level procedure (i) § 13.5 page 21 / § 13.6 page 21 Inis LED illuminates to show that the following welding mode is selected: MMA L14 DDC This LED illuminates to show that the following welding mode is selected: TIG CONTINUOUS This LED illuminates to show that the following welding mode is selected: TIG PULSED Parameters/functions setting: 1st level menu: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: 1st level menu: The displays show "L.2". Welding: The displays show the value of the following parameter wellow CURRENT Parameters/functions setting: The displays show the selected parameter and its value. Welding: The displays show the average instantaneous voltage value. HOLD function: The displays show the average voltage value of the last weld executed. The "HOLD" value is cleared when a new weld is started, or when any action is performed on the user interface. DC TIG mode: Press the button to select the parameter to be set. Possible choices: OSTART OYNAMIC ARC MULTI-TACK Press the button once to open the JOB upload menu. Hold down the button for 3 seconds to gain access to the JOB save/delete menu.	L7	SYN	When this is on, it means that the synergic mode is active and that the operator can set just the welding current while the other parameters are
Illumination shows that the following function has been activated: 2 times procedure \$ 13.1 page 20 / \$ 13.2 page 20 Illumination shows that the following function has been activated: 4 times procedure \$ 13.3 page 20 / \$ 13.4 page 21 Illumination shows that the following function has been activated: 4 times Bi-level procedure \$ 13.5 page 21 / \$ 13.6 page 21 Illumination shows that the following function has been activated: 4 times Bi-level procedure \$ 13.5 page 21 / \$ 13.6 page 21 Illumination shows that the following function has been activated: 4 times Bi-level procedure \$ 13.5 page 21 / \$ 13.6 page 21 Illumination shows that the following welding mode is selected: MMA Illumination shows that the following welding mode is selected: TIG CONTINUOUS Inlumination shows that the following welding mode is selected: TIG PULSED Parameters/functions setting: 1st level menu: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: 1st level menu: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: 2nd level menu: The displays show "L.2". Welding: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: The displays show the selected parameter and its value. Welding: The displays show the average instantaneous voltage value. HOLD function: The displays show the average voltage value of the last weld executed. The "HOLD" value is cleared when a new weld is started, or when any action is performed on the user interface. Start	L8	HF	Illumination shows that the following function has been activated: High frequency arc strike (HF)
Illumination shows that the following function has been activated: 2 times procedure \$ 13.1 page 20 / \$ 13.2 page 20 Illumination shows that the following function has been activated: 4 times procedure \$ 13.3 page 20 / \$ 13.4 page 21 Illumination shows that the following function has been activated: 4 times Bi-level procedure \$ 13.5 page 21 / \$ 13.6 page 21 Illumination shows that the following function has been activated: 4 times Bi-level procedure \$ 13.5 page 21 / \$ 13.6 page 21 Illumination shows that the following function has been activated: 4 times Bi-level procedure \$ 13.5 page 21 / \$ 13.6 page 21 Illumination shows that the following welding mode is selected: MMA Illumination shows that the following welding mode is selected: TIG CONTINUOUS Inlumination shows that the following welding mode is selected: TIG PULSED Parameters/functions setting: 1st level menu: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: 1st level menu: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: 2nd level menu: The displays show "L.2". Welding: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: The displays show the selected parameter and its value. Welding: The displays show the average instantaneous voltage value. HOLD function: The displays show the average voltage value of the last weld executed. The "HOLD" value is cleared when a new weld is started, or when any action is performed on the user interface. Start	L9	O ₃	This LED indicates that the current reference setting is imposed by the remote controller.
Illumination shows that the following function has been activated: 4 times Bi-level procedure Illumination shows that the following function has been activated: 4 times Bi-level procedure Illumination shows that the following welding mode is selected: MMA Init	L10		
This LED illuminates to show that the following welding mode is selected: MMA L14	L11	JD)	
This LED illuminates to show that the following welding mode is selected: TIG CONTINUOUS This LED illuminates to show that the following welding mode is selected: TIG PULSED Parameters/functions setting: 1st level menu: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: 2nd level menu: The displays show "L.2". Welding: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: The displays show the selected parameter and its value. Welding: The displays show the average instantaneous voltage value. HOLD function: The displays show the average voltage value of the last weld executed. The "HOLD" value is cleared when a new weld is started, or when any action is performed on the user interface. DC TIG mode: Press the button to select the parameter to be set. Possible choices: O-START DYNAMIC ARC MULTI-TACK Press the button once to open the JOB upload menu. Hold down the button for 3 seconds to gain access to the JOB save/delete menu.	L12	///T	
This LED illuminates to show that the following welding mode is selected: TIG PULSED Parameters/functions setting: 1st level menu: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: 2nd level menu: The displays show "L.2". Welding: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: The displays show the selected parameter and its value. Welding: The displays show the average instantaneous voltage value. HOLD function: The displays show the average voltage value of the last weld executed. The "HOLD" value is cleared when a new weld is started, or when any action is performed on the user interface. DC TIG mode: Press the button to select the parameter to be set. Possible choices: O-START DYNAMIC ARC MULTI-TACK Press the button once to open the JOB upload menu. Hold down the button for 3 seconds to gain access to the JOB save/delete menu.	L13	F	This LED illuminates to show that the following welding mode is selected: MMA
Parameters/functions setting: 1st level menu: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: 2nd level menu: The displays show "L.2". Welding: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: The displays show the selected parameter and its value. Welding: The displays show the average instantaneous voltage value. HOLD function: The displays show the average voltage value of the last weld executed. The "HOLD" value is cleared when a new weld is started, or when any action is performed on the user interface. DC TIG mode: Press the button to select the parameter to be set. Possible choices:	L14	Ç⇒DC	This LED illuminates to show that the following welding mode is selected: TIG CONTINUOUS
Parameters/functions setting: 2nd level menu: The displays show "L.2". Welding: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: The displays show the selected parameter and its value. Welding: The displays show the average instantaneous voltage value. HOLD function: The displays show the average voltage value of the last weld executed. The "HOLD" value is cleared when a new weld is started, or when any action is performed on the user interface. DC TIG mode: Press the button to select the parameter to be set. Possible choices:	L15	<u>Ç⊃w</u>	This LED illuminates to show that the following welding mode is selected: TIG PULSED
Welding: The displays show the value of the following parameter: WELDING CURRENT Parameters/functions setting: The displays show the selected parameter and its value. Welding: The displays show the average instantaneous voltage value. HOLD function: The displays show the average voltage value of the last weld executed. The "HOLD" value is cleared when a new weld is started, or when any action is performed on the user interface. DC TIG mode: Press the button to select the parameter to be set. Possible choices:		-	Parameters/functions setting: 1st level menu: The displays show the value of the following parameter: WELDING CURRENT
Parameters/functions setting: The displays show the selected parameter and its value. Welding: The displays show the average instantaneous voltage value. HOLD function: The displays show the average voltage value of the last weld executed. The "HOLD" value is cleared when a new weld is started, or when any action is performed on the user interface. DC TIG mode: Press the button to select the parameter to be set. Possible choices:	D1		Parameters/functions setting: 2nd level menu: The displays show "L.2".
Welding: The displays show the average instantaneous voltage value. HOLD function: The displays show the average voltage value of the last weld executed. The "HOLD" value is cleared when a new weld is started, or when any action is performed on the user interface. DC TIG mode: Press the button to select the parameter to be set. Possible choices: - Q-START - DYNAMIC ARC - MULTI-TACK Press the button once to open the JOB upload menu. Hold down the button for 3 seconds to gain access to the JOB save/delete menu.			Welding: The displays show the value of the following parameter: WELDING CURRENT
HOLD function: The displays show the average voltage value of the last weld executed. The "HOLD" value is cleared when a new weld is started, or when any action is performed on the user interface. DC TIG mode: Press the button to select the parameter to be set. Possible choices: - Q-START - DYNAMIC ARC - MULTI-TACK Press the button once to open the JOB upload menu. Hold down the button for 3 seconds to gain access to the JOB save/delete menu.			Parameters/functions setting: The displays show the selected parameter and its value.
HOLD function: The displays show the average voltage value of the last weld executed. The "HOLD" value is cleared when a new weld is started, or when any action is performed on the user interface. DC TIG mode: Press the button to select the parameter to be set. Possible choices:	D2		Welding: The displays show the average instantaneous voltage value.
S1 O-START DYNAMIC ARC MULTI-TACK Press the button once to open the JOB upload menu. Hold down the button for 3 seconds to gain access to the JOB save/delete menu.			HOLD function: The displays show the average voltage value of the last weld executed. The "HOLD" value is cleared when a new weld is started, or when any action is performed on the user interface.
Hold down the button for 3 seconds to gain access to the JOB save/delete menu.	S1	\bigcirc	- Q-START - DYNAMIC ARC
S3 Press the button once to select the parameters of the first level menu.	S2		Press the button once to open the JOB upload menu. Hold down the button for 3 seconds to gain access to the JOB save/delete menu.
	S3	Menu	Press the button once to select the parameters of the first level menu.

03/06/2015 v2.3 ENGLISH

CODE	SYMBOL	DESCRIPTION
		Hold down the button for 3 seconds to gain access to the second level menu. Hold down the button at the time of power-on to gain access to the SETUP menu.
S4	\bigcirc	DC TIG mode: This button selects the torch trigger procedure. § 13 page 20
S5	\bigcirc	This button selects the welding mode.
		Parameters/functions setting: The encoder provides the facility to alter the selected parameter.
LI	9	Welding: The encoder allows the welding current to be modified.

6 UNIT POWER-UP

Set the welding power source ON/OFF switch to "I" to switch on the unit.

⊕ GL 222 DC Fx.x

The message appears on the following displays: D2

x.x= software version

First power-up or power-ups following a RESET procedure

The welding power source sets up for welding with the factory presets.

Subsequent power-ups

The welding power source sets up for welding in the latest stable welding configuration that was active at the time of power-off.

7 RESET (LOAD FACTORY SETTINGS)

The reset procedure involves complete restoration of the default values, parameters and memory settings set in the factory. The reset procedure is useful in the following cases:

- Too many changes made to the welding parameters so user finds it difficult to restore defaults.
- Unidentified software problems that prevent the welding power source from functioning correctly.

7.1 PARTIAL RESET

The reset procedure involves restoration of the parameter values and settings, except the following settings:

- settings of the SETUP menu
- saved JOBS
- set language

Set the welding power source ON/OFF switch to "O" to switch the unit off.

S3 (Nov) S5 (Thold down both buttons simultaneously.

Set the welding power source ON/OFF switch to "I" to switch on the unit.



★ RECALL PARTIAL SETUP? The message appears on the following displays: D2

Exit without confirmation

Press any button (except S2).

This action will automatically close the menu.

Exit with confirmation

S3 (Meru) Press the button.

This action will automatically close the menu.Wait for the memory clear procedure to terminate.

9/28

7.2 **TOTAL RESET**

The reset procedure involves complete restoration of the default values, parameters and memory settings set in the factory. All memory locations will be reset and hence all your personal welding settings will be lost!

Set the welding power source ON/OFF switch to "O" to switch the unit off.

S3 $\stackrel{\text{Nev}}{}$ S5 $\stackrel{\text{Hold}}{\bigcirc}$ Hold down both buttons simultaneously.

Set the welding power source ON/OFF switch to "I" to switch on the unit.



SIMULTANEOUS ACTIONS

RECALL PARTIAL SETUP?

The message appears on the following displays: D2

E1 Select the following setting with the encoder:

RECALL FACTORY SETUP?

Exit without confirmation

- Press any button (except S2).
- This action will automatically close the menu.

Exit with confirmation

- S3 Press the button.
 - The message appears on the following displays: D2
 - This action will automatically close the menu. Wait for the memory clear procedure to terminate.

8 SET-UP (INITIAL SET-UP OF THE WELDING POWER SOURCE)

Set the welding power source ON/OFF switch to "O" to switch the unit off.

S3 Men Hold down the button.

Set the welding power source ON/OFF switch to "I" to switch on the unit.

SET UP The message appears for a few seconds on the following displays: D2

PILOT ARC

SELECT LANGUAGE:

The message appears on the following displays: D2

- S3 Ween Use this button to scroll the settings to edit.
- E1 Using the encoder, edit the value of the selected setting.
 - Press any key (except S3) to save the setting and quit the menu.

Tab. 1 - Setup settings MIN DEFAULT MAX SETTING ITALIANO **ENGLISH FRANÇAIS** DEUTSCH **ESPAÑOL** SELECT LANGUAGE: **DUTCH PORTUGUES** SUOMI **CESKY POLSKI** DANSK COOLER ACTIVATION OFF AHT ON START CURRENT % Α Α FINAL CURRENT % *1 Α Α **CURRENT HF** 20 A SYN 220 A KIND OF PULSE SLOW (*2) SLOW FAST (*3)

OFF

ON

*1: The value of this parameter can be set as a percentage of the welding current or as an absolute value expressed in Amperes.

OFF

- *2: This setting enables slow pulsed mode.
- *3: This setting enables fast pulsed mode.

ENGLISH

Cooler activation

- ON= The cooler is always running when the power source is switched on. This mode is preferable for heavy duty and automatic welding procedures.
- OFF= The cooler is always disabled because an air-cooled torch is in use.
- AUT= When the unit is switched on the cooler is switched on for 16 s. During welding procedures the cooler runs constantly. When welding is
 terminated the cooler continues to run for 90 s + a number of seconds equivalent to the average current value shown using the HOLD
 function.

Current HF

This parameter establishes the current value during HF discharge. The value of this parameter can be set as an absolute value or in SYN. With SYN setting the HF current value is calculated automatically on the basis of the preset welding current value. Consequences of a higher value:

- Arc striking is facilitated, even on very dirty workpieces.
- Risk of piercing excessively thin gauge workpieces.

Pilot arc

The function enables the output of a low current between the 1st and 2nd times of the torch trigger to shield the mask in advance and avoid the risk of blinding flashback caused by the welding current.

GL 222 DC ENGLISH

8.1 TORCH LOADING



WARNING!

Make sure the torch in use is correctly sized in relation to the welding current required and for the available and selected cooling type. This prevents the risk of burns to which the operator is potentially exposed, potential faults, and irreversible damage to the torch and the system. If a torch is installed or replaced while the unit is running, the circuit of the newly installed must be filled with coolant to avoid the risk of damage to the torch in the case of high voltage arc strikes without any liquid in the circuit.

Power-up with operation of the cooler set to "ON" or "AUTO" mode

A check is performed automatically of the presence of liquid in the cooling circuit and the cooler is switched on for 15 seconds.

If the coolant circuit is full, the power source sets up in the most recent stable welding configuration.

If the coolant circuit is not full, all functions are inhibited and there will be no output power present.

COOLING DEVICE ALARM The message appears on the following displays: D2

(any) Press the button or torch trigger to repeat the checking procedure for an additional 15 seconds. If the problem persists rectify the cause of the alarm.

Power-up with operation of the cooler set to "OFF"

- Operation of the cooler and the cooler alarm are disabled.
- Welding is performed without liquid cooling of the torch.

Torch change-over with operation of the cooler set to "ON"

Press and release the torch trigger.

This serves to start the cooler for 15 seconds to fill the torch cooling circuit.

9 ALARMS MANAGEMENT

- This LED illuminates if an incorrect operating condition occurs.
- An alarm message appears on the following display: D2


Tah 2 - Alarm massages

	Tab. 2 - Alarm messages						
MESSAGE	MEANING	EVENT	CHECKS				
THERMAL ALARM!	Overheating alarm Indicates tripping of the welding power source thermal protection. Leave the unit running so that the overheated components cool as rapidly as possible. When the unit has cooled, the welding power source will reset automatically.	All functions disabled. Exceptions: - cooling fan. cooler (if switched on).	Make sure that the power required by the welding process is lower than the maximum rated power output. Check that the operating conditions are in compliance with the welding power source data plate specifications. Check for the presence of adequate air circulation around the welding power source.				
COOLING DEVICE ALARM	Cooler alarm Indicates insufficient pressure in the torch liquid cooling circuit.	All functions disabled. Exceptions: - cooling fan. The alarm message persists on the display until the first operation is performed on the user interface. - Cooler ON: the alarm is signalled as long as the unit alarm is active and the cooler presence signal persists. - Cooler OFF: the alarm is never signalled, irrespective of the circumstances. - Cooler AUT: the alarm is signalled at the times in which the unit is running; the alarm signal occurs as long as the unit presence signal persists.	Check that the connection to the cooler is correct. Check that the O/I switch is set to I and that it illuminates when the pump is running. Check that the cooler is filled with coolant. Check that the cooling circuit is liquid tight, notably the torch hoses and the internal connections of the cooler.				

ENGLISH

10 WELDING PARAMETERS

For a better understanding of the parameter functions described in the table, refer to the following diagram.

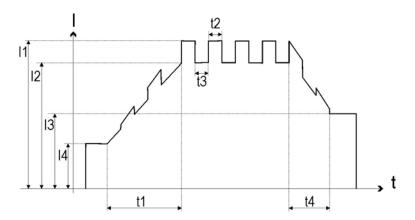

- (I1) TIG WELDING CURRENT
- (I2) BASE CURRENT
- (I3) FINAL CURRENT
- (I4) STARTING CURRENT
- (t1) UP SLOPE TIME
- (t2) PEAK TIME
- (t3) BASE TIME
- (t4) DOWN SLOPE TIME

(1/t2+t3) PULSED CURRENT FREQUENCY

Welding current

Output current value during welding.

Max welding current

Maximum output current value that can be achieved with remote controller external reference.

Hot-start

This parameter aids electrode melting at the time of arc striking. Consequences of a higher value:

- Easier arc strike.
- Increased spatter at welding start.
- Increase of strike area.

Consequences of a lower value:

- More difficult arc strike.
- Less spatter at welding start.
- Smaller strike area.

Arc-force

This parameter helps to avoid electrode sticking during welding. Consequences of a higher value:

- Fluidity during welding.
- Welding arc stability.
- Greater electrode fusion in workpiece.
- More welding spatter.

Consequences of a lower value:

- The arc is extinguished more easily.
- Less welding spatter.

VRD

This parameter reduces the potential across the welding sockets when welding is not in progress.

The arc strike procedure is as follows:

- Touch the workpiece with the electrode tip.
- Raise the electrode.

Power is released for several seconds.

Touch the workpiece with the electrode tip.

The welding arc will strike.

Long arc voltage

This parameter inhibits power output when the potential between electrode and workpiece exceeds the preset threshold level.

Consequences of a higher value:

 The welding arc persits even with a significant distance between the electrode and the workspiece.

Consequences of a lower value:

Faster exit from weld.

Remote control

This parameter enables the unit to receive the current reference signal from a remote control.

Dynamic arc

Welding power remains constant even when the distance between electrode and workpiece changes.

Consequences of a higher value:

- The welding arc concentration remains unchanged.
- Prevents electrode sticking.
- Thin workpieces may become deformed more easily.

Second current Bi-level

With a rapid press and release (less than 0.5 seconds) of the torch trigger during welding, the output current value switches to the value set by means of the "bi-level second current" parameter.

In DC TIG welding, the parameter is useful when welding different gauge workpieces during the same pass; when moving between different gauges the output current can be changed simply by pressing the torch trigger.

In AC TIG welding the parameter is useful to change the heat output during welding; when the workpiece heats up to the point at which there is a risk of deformation, the current value (= heat) can be reduced simply by pressing the torch trigger.

Base current

Pulsed wave minimum current.

Consequences of a higher value:

- Faster creation of weld pool.
- Increase of heat-affected zone.

ENGLISH

Peak time

Time for which the current pulse is at the maximum value.

Consequences of a higher value:

- Greater weld penetration.
- Facility to make deeper cuts.

Consequences of a lower value:

- Reduction of heat-affected zone.
- Difficult to create a weld pool.

Base time

Time during which current output is at the base value.

Consequences of a higher value:

- The filler material is spread more evenly.
- Increase of heat-affected zone.

Pulse frequency

Consequences of a higher value:

- Slower melt speed.
- Reduction of heat-affected zone.

Slope down

Time during which the current changes from the welding value to the end value by means of a slope.

Final current

During electrode welding the parameter makes it possible to obtain a uniform deposit of filler material from the start to the end of the welding process, closing the deposition crater with a current such as to deposit a final droplet of filler material.

By keeping the torch trigger pressed during the 3rd time, the crater filler current is maintained thereby ensuring optimal crater filling, until the POST GAS time is started by releasing the torch trigger (4Th time).

Post-gas

Time of post gas delivery when the welding arc is extinguished. Consequences of a higher value:

- More effective pickling (improved appearance of workpiece at the end of the welding pass).
- Higher gas consumption.

Consequences of a lower value:

- Lower gas consumption.
- Oxidation of electrode tip (more difficult arc strike).

Pre-gas

Time of gas delivery before the arc strike.

Consequences of a higher value:

 This parameter allows a shielded environment to be created, thereby eliminating contaminants at the start of the welding pass.

Start current

Unit current output value immediately after the arc strike.

Slope up

Time during which the current changes from the starting value to the welding value by means of a slope.

Spot TIG time

When the torch trigger is pressed the welding arc persists for the time set in the parameter.

Press the torch trigger again to resume the welding process.

The arc strike procedure is as follows:

Positioning of the torch with the electrode on the workpiece.

Press the torch trigger and keep it pressed.

Lift the torch slightly.

As soon as the electrode is lifted then the HF ignition starts.

The arc ignites for few hundredths of a second (time can be set up).

The result of this is a very precise, not oxidized welding spot without any plastic deformation of the sheet.

HF arc start

This parameter enables the arc strike in the TIG welding procedure by means of a high frequency (HF) current discharge.

The parameter prevents the inclusion of impurities at the start of the weld pass.

This parameter can harm electronic boards when welding is performed on equipment that incorporates such devices.

Minimum pedal current

Minimum output current value with foot pedal controller external reference.

The current is set as a percentage with respect to the "maximum foot pedal current" parameter.

Q-start

This parameter allows the unit to start in synergic pulsed TIG mode for the preset time interval, before switching automatically to the welding procedure selected on the interface panel.

The parameter creates a weld pool faster with respect to the standard starting procedure.

This parameter is useful when spot welding thin gauge sheet.

Multi-tack

This parameter allows thin gauge sheet to be welded without deformation.

Consequences of a higher value:

- Welding of thinner gauge sheet without deformation.
- Less melting of material, slower welding process.

ENGLISH

10.1 PARAMETERS ACTIVATION

The welding parameters are available in accordance with the selected welding mode and procedure.

Certain parameters are available only after other parameters or functions of the unit have been enabled or set.

The table shows the settings required to enable each parameter.

✓: always available

1: Available with the user interface reference active

2: Available with "REMOTE CONTROL"= ON and remote controller connected

3: Available when "HF ARC START" parameter =ON

4: Not available with "MULTI TACK" active

5: Available with "KIND OF PULSE"= SLOW

6: Available with "KIND OF PULSE" = FAST

MENU	MODE →	P		Ç	> 			C	<u>™</u>			<i>Ç</i> =	SYN	
*	PROCEDURE →		Ø.	SPT	IJ)		Ø	SPT	IJ)	W-	Ø.	SPT		//j~
	PARAMETER ▼													
1°	WELDING CURRENT	1	1	1	1	1	1	1	1	1	1	1	1	1
1°	MAX WELDING CURRENT	2	2	2			2	2			2	2		
1°	HOT-START	✓												
1°	ARC-FORCE	✓												
1°	PRE-GAS		3	3	3	3	3	3	3	3	3	3	3	3
1°	START CURRENT		✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
1°	SLOPE UP		4	4	4	4	4	4	4	4	4	4	4	4
1°	SECOND CURRENT BI-LEVEL					✓				✓				✓
1°	BASE CURRENT						✓	✓	✓	✓	✓	✓	✓	✓
1°	PEAK TIME DUTY CYCLE						✓	~	✓	✓	✓	✓	✓	✓
1°	PULSE FREQUENCY						6	6	6	6	6	6	6	6
1°	BASE TIME						5	5	5	5	5	5	5	5
1°	SLOPE DOWN		4	4	4	4	4	4	4	4	4	4	4	4
1°	POST-GAS		✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
2°	VRD	✓												
2°	LONG ARC VOLTAGE	✓												
2°	REMOTE CONTROL	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
2°	FINAL CURRENT		4	4	4	4	4	4	4	4	4	4	4	4
2°	SPOT TIG TIME			✓				✓				✓		
2°	MINIMUM PEDAL CURRENT		2	2			2	2			2	2		
2°	HF ARC START		✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
SPECIAL	Q-START		3 + 4		3 + 4	3 + 4	3 + 4		3 + 4	3 + 4				
SPECIAL	DYNAMIC ARC	✓	4		4		4		4					
SPECIAL	MULTI-TACK		3		3		3		3		3		3	

GL 222 DC ENGLISH

11 **WELDING SETTINGS**

ELECTRODE WELDING (MMA) 11.1

This button serves to select the following welding mode:



11.1.1 MMA PARAMETERS SETTING (1ST LEVEL)

S3 Press this button to scroll the list of settings to edit.

The selected parameter and its value are shown on the following displays: D2

Using the encoder, edit the value of the selected setting.

The value is saved automatically.

Press any key (except S3) to save the setting and quit the menu.

Tab. 3 - Parameters of the 1st level menu in MMA mode

PARAMETER	MIN	DEFAULT	MAX	-
WELDING CURRENT	10 A	80 A	180 A	-
MAX WELDING CURRENT	5 A	80 A	180 A	-
HOT-START	0 %	50 %	100 %	*1
ARC-FORCE	0 %	30 %	100 %	*1

^{*1:} This parameter is set as a percentage referred to the value of the following parameter: WELDING CURRENT

11.1.2 MMA PARAMETERS SETTING (2ND LEVEL)

S3 Model Hold down the button for 3 seconds to gain access to the 2nd level menu.

€ L.2 The message appears on the following displays: D1

L.2= LEVEL.2= 2ND LEVEL MENU

The selected parameter and its value are shown on the following displays: D2

S3 Press this button to scroll the list of settings to edit.

Using the encoder, edit the value of the selected setting.

The value is saved automatically.

Press any key (except S3) to save the setting and quit the menu.

Tab. 4 - Parameters of the 2nd level menu in MMA mode

PARAMETER	MIN	DEFAULT	MAX	
VRD	OFF	OFF	ON	*3
LONG ARC VOLTAGE	37	SYN	65	*4
REMOTE CONTROL	OFF	OFF	ON	*2

- *2: The activation is suitable for the following welding modes:
- MMA
- DC TIG
- **AC TIG**

Compatible remote control types:

- manual remote controller.
- *3: The activation is suitable for the following welding modes:
- MMA
- *4: SYN: This code indicates that parameters control is synergic. The optimal value of this parameter is set automatically by the microprocessor on the basis of the preset welding current value. This value can be displayed but it is not user-adjustable.

11.1.3 MMA SPECIAL FUNCTIONS

S1 Press this button to scroll the list of settings to edit.

The selected parameter and its value are shown on the following displays: D2

E1 Using the encoder, edit the value of the selected setting.

The value is saved automatically.

Press any key (except S1) to save the setting and quit the menu.

Tab. 5 - Special functions in MMA mode

PARAMETER	MIN	DEFAULT	MAX
DYNAMIC ARC	OFF	OFF	ON

11.2 DC TIG WELDING

11.2.1 DC TIG PARAMETERS SETTING (1ST LEVEL)

- S3 Press this button to scroll the list of settings to edit.
 - The selected parameter and its value are shown on the following displays: D2
- E1 Using the encoder, edit the value of the selected setting. The value is saved automatically.
 - Press any key (except S3) to save the setting and quit the menu.

Tab. 6 - 1st level menu parameters in DC TIG mode

PARAMETER	MIN	DEFAULT	MAX	•
WELDING CURRENT	5 A	80 A	220 A	•
MAX WELDING CURRENT	5 A	80 A	220 A	
SECOND CURRENT BI-LEVEL	10 %	50 %	200 %	*1
BASE CURRENT	1 %	40 %	200 %	
DASE CURRENT	SYN	SYN	SYN	*3
PEAK TIME	0.1 s	5.0 s	5.0 s	*5
DUTY CYCLE	1 %	50 %	99 %	*4
DUTT CTCLE	SYN	SYN	SYN	*3
BASE TIME	0.1 s	5.0 s	5.0 s	*5
	0.1 Hz	100 Hz	2.5 kHz	*4
PULSE FREQUENCY	0.1 Hz	5.0 Hz	5.0 Hz	*5
	SYN	SYN	SYN	*3
SLOPE DOWN	0.0 s	0.0 s	25.0 s	
FINAL CURRENT	5 %	5 %	80 %	*2
FINAL CURRENT	5 A	5 A	220 A	*2
POST-GAS	0.0 s	10.0 s	25.0 s	
PRE-GAS	0.0 s	0.1 s	10.0 s	
START CURRENT	2 %	50 %	200 %	
START CURRENT	5 A	50 A	220 A	
SLOPE UP	0.0 s	0.0 s	25.0 s	
·				-

- *1: This parameter is set as a percentage referred to the value of the following parameter: WELDING CURRENT
- *2: The value of this parameter can be set as a percentage of the welding current or as an absolute value expressed in Amperes.
- *3: SYN: This code indicates that parameters control is synergic. The optimal value of this parameter is set automatically by the microprocessor on the basis of the preset welding current value. This value can be displayed but it is not user-adjustable.
- *4: Available when "KIND OF PULSE" parameter= FAST
- *5: Available when "KIND OF PULSE" parameter= SLOW

11.2.2 DC TIG PARAMETERS SETTING (2ND LEVEL)

- S3 Access the 2nd level menu by holding the button down for 3 seconds.
 - $\ensuremath{\bigodot}$ L.2 The message appears on the following displays: D1

L.2= LEVEL.2= 2ND LEVEL MENU

- S3 (Menu) Press this button to scroll the list of settings to edit.
 - The selected parameter and its value are shown on the following displays: D2
- E1 Using the encoder, edit the value of the selected setting.

 The value is saved automatically.
 - Press any key (except S3) to save the setting and quit the menu.

ENGLISH

PARAMETER	MIN	DEFAULT	MAX	•
SPOT TIG TIME	0.01 s	0.1 s	10.0 s	
HF ARC START	ON	ON	OFF	=
REMOTE CONTROL	OFF	OFF	ON	*1
MINIMUM PEDAL CURRENT	1 %	50 %	90 %	*2

- *1: The activation is suitable for the following welding modes:
- MMA
- DC TIG
- AC TIG

Compatible remote control types:

- manual remote controller.
- UP/DOWN or potentiometer TIG torch.
- foot pedal controller.

The maximum and minimum TIG welding current values can be set with the foot pedal controller.

The up slope and down slope cannot be controlled via the foot pedal.

The following welding procedures can be selected with the foot pedal:

If both remote controllers are connected, the foot pedal assumes priority over the UP/DOWN or potentiometer TIG torch.

When this function is active welding is performed without the following parameters:

- SLOPE UP
- SLOPE DOWN
- All special functions
- *2: This parameter is set as a percentage referred to the value of the following parameter: WELDING CURRENT

11.2.3 DC TIG SPECIAL FUNCTIONS MENU

- S1 Press this button to scroll the list of settings to edit.
 - The selected parameter and its value are shown on the following displays: D2
- E1 Using the encoder, edit the value of the selected setting.

The value is saved automatically.

Press any key (except S1) to save the setting and quit the menu.

Tab. 8 - Special functions in DC TIG

PARAMETER	MIN	DEFAULT	MAX	,
DYNAMIC ARC	OFF	OFF	ON	*3
Q-START	0.1 s	OFF	60.0 s	*3
MULTI-TACK	0.5 Hz	OFF	6.0 Hz	*2 *3

- *2: When this function is active welding is performed without the following parameters:
- SLOPE UP
- SLOPE DOWN
- START CURRENT
- FINAL CURRENT
- DYNAMIC ARC
- Q-START
- *3: When "REMOTE CONTROL" = ON and a foot pedal is connected the functions are all inhibited.

12 JOBS MANAGEMENT

Personalised welding settings, or JOBs, can be saved in memory locations and subsequently uploaded.

Up to 50 jobs can be saved (j01-j50).

The settings of the SETUP menu are not saved.

12.1 SAVING A JOB

This function is available when welding mode is not active.

- - → JOB STORAGE SELECTION The message appears on the following displays: D2
- S5 Press the button to confirm.

xx= number of the first free job.

- JOB MEMORY FULL When there are no free memory locations the message appears on the following displays: D2
- E1 Use the encoder to select the required job number.

On selecting a currently occupied memory location, the job number flashes.

If you confirm at this point, the new job will overwrite the previously saved settings.

Exit without confirmation

Press any button (except S2).

This action will automatically close the menu.

Exit with confirmation

S2 Press the button.

This action will automatically close the menu.

12.2 LOADING A USER JOB OF FACTORY SET JOB

This function is available when welding mode is not active.

- S2 Press and release the button.
 - **EXECUTE:** Only when the jobs have been uploaded, the message is shown on the following displays: D2 xx= number of the latest job used.
 - NO JOB LOADED If there are no jobs in the memory the message is shown on the following displays: D2
- E1 Use the encoder to select the number of the job to be uploaded.

Exit without confirmation

Press any button (except S2).

This action will automatically close the menu.

Exit with confirmation

- S2 Press the button.
 - **LOADED JOB N.xx** The message appears on the following displays: D2

This action will automatically close the menu.

When a job is loaded and an UP/DOWN torch is installed, press the torch triggers to select the saved jobs.

12.3 DELETING A JOB

This function is available when welding mode is not active.

- S2 Hold down the button for 3 seconds.
 - JOB STORAGE SELECTION The message appears on the following displays: D2
- E1 Select the following setting with the encoder:
 - JOB ERASURE SELECTION The message appears only if there are saved JOBS, on the following displays: D2
- S2 Press the button to confirm.
 - - xx= number of the latest job used.

ENGLISH

NO STORED JOB

The message appears only if there are saved JOBS, on the following displays: D2

E1 Use the encoder to select the number of the job to be deleted.

Exit without confirmation

Press any button (except S2).

This action will automatically close the menu.

Exit with confirmation

S2 Press the button.

This action will automatically close the menu.

13 TORCH TRIGGER MODES

13.1 2T LIFT-ARC WELDING

- 1. Touch the workpiece with the torch electrode.
- 2. Press (1T) and keep the torch trigger pressed.
- 3. Slowly lift the torch to strike the arc.
- The welding current reaches the preset value, by way of a up slope time, if programmed.
- 4. Release (2T) the trigger to start the weld completion procedure.
- The current reaches the end current value in the time set in the down slope time parameter.
- The arc is extinguished.
- Gas delivery continues for the time set in the post gas parameter.

13.2 2T HF WELDING

- 1. Bring the torch up to the work until the electrode tip is approximately 2 or 3 mm away.
- 2. Press (1T) and keep the torch trigger pressed.
- The arc strikes without contact with the workpiece and the voltage discharges (HF) cease automatically.
- The welding current reaches the preset value, by way of a up slope time, if programmed.
- 3. Release (2T) the trigger to start the weld completion procedure.
- The current reaches the end current value in the time set in the down slope time parameter.
- The arc is extinguished.
- Gas delivery continues for the time set in the post gas parameter.

13.3 4T LIFT-ARC WELDING

- 1. Touch the workpiece with the torch electrode.
- 2. Press (1T) and release (2T) the torch trigger.
- 3. Slowly lift the torch to strike the arc.
- The welding current reaches the preset value, by way of a up slope time, if programmed.
- 4. Press (3T) the trigger and keep it pressed to start the weld completion procedure.
- The current reaches the end current value in the time set in the down slope time parameter.
- The arc continues and the current output will be the value set in the end current. parameter.
- In these conditions the weld pool can be closed (crater filler current).
- 5. Release (4T) the trigger to extinguish the arc.
- Gas delivery continues for the time set in the post gas parameter.

13.4 4T HF WELDING

- 1. Bring the torch up to the work until the electrode tip is approximately 2 or 3 mm away.
- 2. Press (1T) and release (2T) the torch trigger.
- The arc strikes without contact with the workpiece and the voltage discharges (HF) cease automatically.
- The welding current reaches the preset value, by way of a up slope time, if programmed.
- 3. Press (3T) the trigger and keep it pressed to start the weld completion procedure.
- The current reaches the end current value in the time set in the down slope time parameter.
- The arc continues and the current output will be the value set in the end current. parameter.
- in these conditions the weld pool can be closed (crater filler current).
- 4. Release (4T) the trigger to extinguish the arc.
- Gas delivery continues for the time set in the post gas parameter.

13.5 BI-LEVEL LIFT WELDING

- 1. Touch the workpiece with the torch electrode.
- 2. Press (1T) and release (2T) the torch trigger.
- 3. Slowly lift the torch to strike the arc.
- The welding current reaches the preset value, by way of a up slope time, if programmed.
- 4. Press and immediately release the torch trigger to switch to the second welding current.
- The trigger must not be pressed for more than 0.3 seconds; otherwise, the weld completion stage will start.
- When the trigger is pressed and released immediately, the system returns to the welding current.
- 5. Press (3T) the trigger and keep it pressed to start the weld completion procedure.
- The current reaches the end current value in the time set in the down slope time parameter.
- The arc continues and the current output will be the value set in the end current. parameter.
- in these conditions the weld pool can be closed (crater filler current).
- 6. Release (4T) the trigger to extinguish the arc.
- Gas delivery continues for the time set in the post gas parameter.

13.6 BI-LEVEL HF WELDING

- 1. Bring the torch up to the work until the electrode tip is approximately 2 or 3 mm away.
- 2. Press (1T) and release (2T) the torch trigger.
- The arc strikes without contact with the workpiece and the voltage discharges (HF) cease automatically.
- The welding current reaches the preset value, by way of a up slope time, if programmed.
- 3. Press and immediately release the torch trigger to switch to the second welding current.
- The trigger must not be pressed for more than 0.3 seconds; otherwise, the weld completion stage will start.
- ① When the trigger is pressed and released immediately, the system returns to the welding current.
- 4. Press (3T) the trigger and keep it pressed to start the weld completion procedure.
- The current reaches the end current value in the time set in the down slope time parameter.
- The arc continues and the current output will be the value set in the end current. parameter.
- in these conditions the weld pool can be closed (crater filler current).
- 5. Release (4T) the trigger to extinguish the arc.
- Gas delivery continues for the time set in the post gas parameter.

13.7 2T SPOT WELDING

- 1. Touch the workpiece with the torch electrode.
- 2. Press (1T) and keep the torch trigger pressed.
- 3. Slowly lift the torch to strike the arc.
- 4. Release (2T) the torch trigger.
- The welding current reaches the preset value, by way of a up slope time, if programmed.
- The welding procedure continues, at the preset current, for the time set with the spot time parameter.
- The current reaches the end current value in the time set in the down slope time parameter.
- The arc is extinguished.
- Gas delivery continues for the time set in the post gas parameter.

13.8 2T SPOT HF WELDING

- 1. Bring the torch up to the work until the electrode tip is approximately 2 or 3 mm away.
- 2. Press (1T) the torch trigger.
- The arc strikes without contact with the workpiece and the voltage discharges (HF) cease automatically.
- 3. Release (2T) the torch trigger.
- The welding current reaches the preset value, by way of a up slope time, if programmed.
- The welding procedure continues, at the preset current, for the time set with the spot time parameter.
- The current reaches the end current value in the time set in the down slope time parameter.
- The arc is extinguished.
- Gas delivery continues for the time set in the post gas parameter.

Keep pressed torch trigger procedure

- 1. Bring the torch up to the work until the electrode tip is approximately 2 or 3 mm away.
- 2. Press (1T) the torch trigger.
- The arc strikes without contact with the workpiece and the voltage discharges (HF) cease automatically.
- The welding current reaches the preset value, by way of a up slope time, if programmed.
- The welding procedure continues, at the preset current, for the time set with the spot time parameter.
- The current reaches the end current value in the time set in the down slope time parameter.
- The arc is extinguished.
- Gas delivery continues for the time set in the post gas parameter.
- 3. Touch the workpiece with the torch electrode.
- 4. Slowly lift the torch to strike the arc.

13.9 PILOT ARC WELDING

The pilot arc can be activated in the following torch trigger procedures:

- 4T LIFT-ARC WELDING
- 4 TIMES + HF WELDING (4T HF)
- 4 TIMES BI-LEVEL + HF WELDING (4T BI-LEVEL HF)

The welding procedure with pilot arc differs with respect to the procedure without pilot arc in the part of the torch trigger procedure described below.

LIFT-ARC Welding

- 1. Touch the workpiece with the torch electrode.
- 2. Press (1T) and keep the torch trigger pressed.
- 3. Slowly lift the torch to strike the arc.
- The arc strikes, the welding current assumes the pilot current value.
- 4. Release (2T) the torch trigger.
- The welding current reaches the preset value, by way of a up slope time, if programmed.

etc.

Welding with HF

- 1. Press (1T) and keep the torch trigger pressed.
- The arc strikes without contact with the part and the voltage discharges (HF) cease automatically, the welding current will assume the pilot current value.
- 2. Release (2T) the torch trigger.
- The welding current reaches the preset value, by way of a up slope time, if programmed.

etc.

14


TECHNICAL DATA

Model	GL 222 DC
	EN 60974-1
Construction standards	EN 60974-3
	EN 60974-10 Class A
Supply voltage	1 x 230V ~± 15 % / 50-60 Hz
Mains protection	25 A Delayed
Dimensions (LxDxH)	460 x 230 x 325 mm
Weight	18.5 kg
Insulation class	Н
Protection rating	IP23S
Cooling	AF
Maximum gas pressure	0,5 MPa (5 bar)
Z _{max}	Compliant with EN 61000-3-12 Hook-up not dependent on the supply network

Temperature of the environment				40°C		
remperature of the environment				40 C		
Welding mode		MMA		TIG		
Static characteristic		$\overline{\mathcal{L}}$		7		
Work cycle	-	60 %	100 %	40 %	60 %	100 %
Welding current	- 1	180 A	150 A	220 A	190 A	160 A
Working voltage	,	27.2 V	26.0 V	18.8 V	17.6 V	16.4 V
Maximum input power	-	5.8 KW	4.5 KW	5.2 KW	4.2 KW	3.3 KW
Maximum supply current	,	25.7 A	20.2 A	22.9 A	18.4 A	14.4 A
No-load voltage (U₀)		81 V		81 V		
Reduced no-load voltage (U _r)				5 V		


Arc striking device designed to work with manual guided torch.	
Rated HF peak voltage	13.5 kV

15 SPARE PARTS

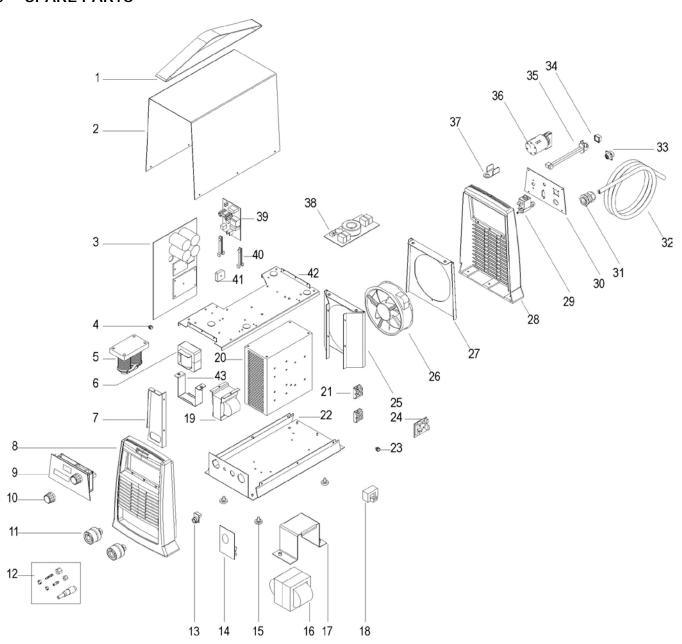

ENGLISH


N°	CODE	DESCRIPTION
1	005.0001.0007	BELT
2	011.0001.0153	COVER PLATE
3	050.0002.0070	POWER BOARD
4	040.0003.1002	TERMAL SWITCH L=200mm
5	010.0002.0004	HF TRANSFORMER
6	044.0004.0017	BOOST INDUCTANCE
7	011.0008.0029	LATERAL PLATE
8	010.0006.0033	FRONT PLASTIC
9	050.5030.4500	FRONT PANEL
10	014.0002.0002	KNOB
11	021.0001.0259	FIXED SOCKET 400 A
12	021.0000.0001	KIT FOR GAS CONNECTORS
13	050.0001.0076	AMPHENOL CONN. BOARD
14	050.0001.0075	OUTPUT FILTER BOARD
15	016.0009.0003	RUBBER FOOT
16	042.0003.0034	POWER TRANSFORMER
17	011.0002.0012	TRANSFORMER SUPPORT
18	041.0004.0300	HALL EFFECT SENSOR
19	044.0004.0019	OUTPUT INDUCTOR
20	015.0001.0006	HEAT SINK
21	032.0002.2003	ISOTOP DIODE
22	011.0008.0001	LOWER COVER
23	040.0003.1002	TERMAL SWITCH L=200mm
24	050.0001.0044	SNUBBER BOARD
25	011.0008.0011	INTERNAL FAN SUPPORT
26	003.0002.0011	FAN
27	011.0008.0010	EXTERNAL FAN SUPPORT
28	010.0006.0034	REAR PLASTIC PANEL
29	010.0001.0007	SOLENOID VALVE
30	013.0012.0500	REAR PANEL
31	045.0000.0007	CABLE CLAMP
32	045.0002.0008	NEOPRENE CABLE
33	022.0002.0079	REMOTE CONTROL WIRING
34	021.0013.0007	ILME CONNECTOR CAP
35	022.0002.0081	C.U. POWER SUPPLY WIRING
36	040.0001.0011	BI-POLE SWITCH
37	011.0002.0018	SOLENOID VALVE PLATE
38	050.0001.0074	MAINS FILTER BOARD
39	050.0002.0027	HF BOARD
40	016.0010.0001	BOARDS SUPPORT
41	032.0001.3506	PRIMARY RECTIFIER
42	011.0008.0020	UPPER PLATE
43	011.0003.0057	BOOST INDUCTANCE SUPPORT

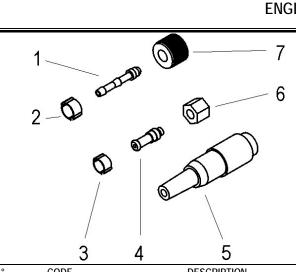

N°	CODE	DESCRIPTION
	021.0000.0001	GAS CONNECTIONS COMPLETE KIT 0001
1	016.5001.0822	SLEEVE HOSE ADAPTER FOR RUBBER HOSE
2	016.0007.0001	HOSE CLAMP Ø=11-13
3	016.0007.0709	HOSE CLAMP Ø=07-09
4	016.5001.0821	SLEEVE HOSE ADAPTER FOR RUBBER HOSE M10
5	021.0004.3360	AMPHT3360-001 M/5V. VOL. CONNECTOR
6	016.5001.1311	NUT M10
7	016.5001.0823	NUT 1/4

16 ELECTRICAL DIAGRAM

16.1 GL 222 DC

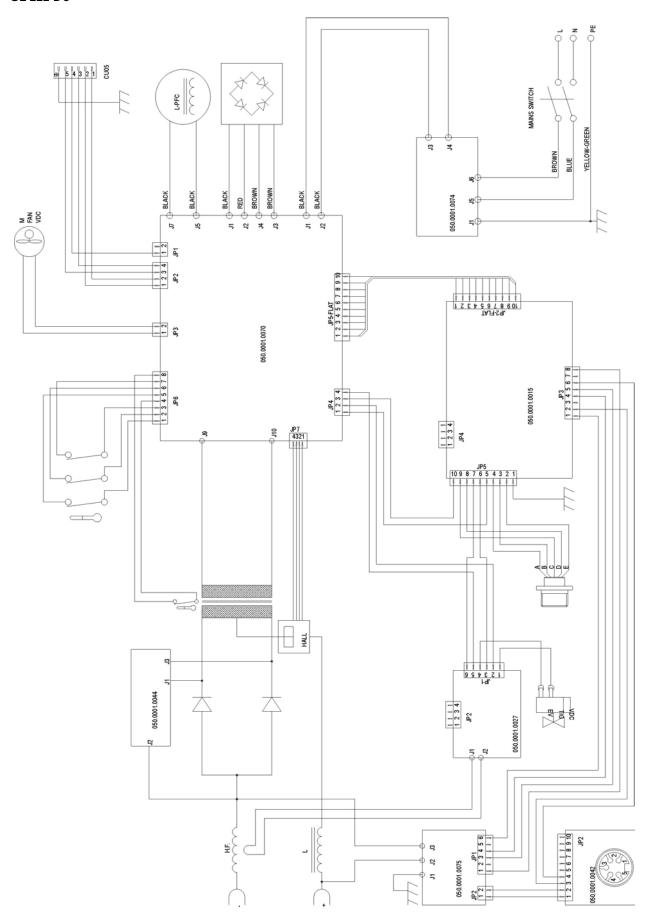


16.2 TORCH CONNECTOR


20 3 04 9 05

cod. 021.0004.3360




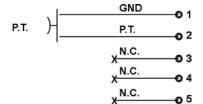


Up & Down Torch

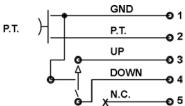

16.3 REMOTE CONTROLLER CONNECTOR

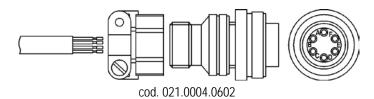


Torch with potentiometer

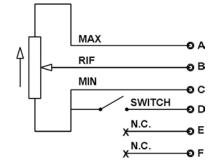


2 kOhm - 10 kOhm potentiometer

Remote Controller

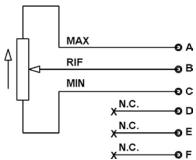

2 kOhm - 10 kOhm potentiometer

Foot pedal controller

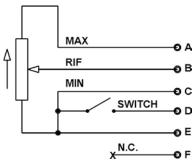

2 kOhm - 10 kOhm potentiometer